



Lot 3

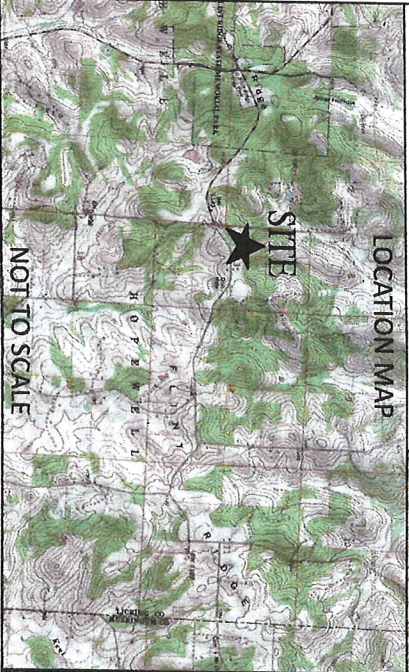

NOTE: SITE PLAN PREPARED USING GARMIN GPS, LICKING CO., AND OGRIP GIS DATA. DATA SHOWN IS ASSUMED CORRECT, BUT HAS NOT BEEN SURVEYED. STRUCTURE LOCATION IS NOT FINAL. DRIVEWAY/STRUCTURE LOCATION SHOULD BE LOCATED ON THE LOT TO ALLOW FOR A LEACH SYSTEM THAT MEETS, OR EXCEEDS, THE MINIMUM LENGTH OF TRENCH REQUIRED.

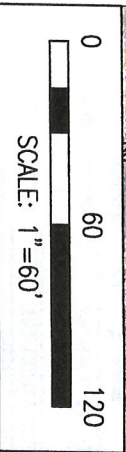

RoxSol

LEGEND

- ☐ LOT
- ☒ TEST PIT
- DRAINAGE

NOTE: DO NOT DISTURB DESIGNATED LEACH FIELD AREAS UNTIL INSTALLATION

COUNTY		COUNTRY
C/O JEFFREY LONGHENRY		
0 FLINT RIDGE RD.,		
NEWARK, OHIO 43055		
PARCEL: 033-103422-00.010		
2' CONTOUR INTERVAL		
SCALE: 1"=60'		
DATE	2/3/25	
REVIEWED BY	KB	




Site and Soil Evaluation for Sewage Treatment and Dispersal

County:	LICKING	Land Use / Vegetation:	UNDEVELOPED	WOODS
Township / Sec.:	HOPEWELL	Landform:	UPLAND	
Property Address/Location:	0 FLINT RIDGE RD. NEWARK, OH 43055	Position on Landform:	HILL/ SLOPE	
Applicant Name:	COUNTRYTIME-J. LONGHENRY	Percent Slope:	12%	
Address:	3451 CINCINNATI-ZANESVILLE RD. LANCASTER, OH 43130	Shape of Slope:	CONVEX	
Phone #:	(614) 989-9394	Date:	February 3, 2025	
Lot #:	033-103422-00-010	Evaluator:	KYLE BALDWIN, GEOLOGIST	
Test Hole #:	4	Signature:	KYLE BALDWIN	
Latitude/Longitude:	39.98911, -82.24337	Phone#:	740-704-1879	
Method:	Pit Auger X Probe			

Soil Profile			Estimating Soil Saturation				Estimating Soil Permeability							Loading Rates			
		Munsell Color (hue, value, chroma)												Infiltration			Linear
	Depth (inches)	Matrix Color	Redoximorphic Features			Texture		Structure									
			Concentrations	Depletions	Class	Approx. % Clay	Approx. % Fragments	Grade	Size	Type (shape)	Consistence	>30BOD	<30BOD	g/0"ft			
A	4	10YR 4/3			SIL	20	0	2	M	GR	FR	0.6	0.8	TBD			
Bt1	20	10YR 5/4			SIL	20	0	2	F	SBK	FR	0.6	0.8	TBD			
2Bt2	34	10YR 5/4	5/6 3/2	10YR 6/2	CL	30	10	2	M	SBK	FI	0.4	0.6	TBD			
2BC	48	10YR 5/4	5/6 3/2	10YR 6/1	CL	30	10	2	CO	SBK	FI	0.4	0.6	TBD			
2C	60	10YR 5/4	5/6 3/2	10YR 6/1	CNCL	30	20	0	0	0	FI	0.0	0.0	TBD			
Limiting Conditions			Depth to (in.)		Descriptive Notes			Remarks / Risk Factors/ Soil Rating:									
Perched Seasonal Water Table			20		REDOXIMORPHIC FEATURES PRESENT												
Apparent Water Table			N/O		NOT OBSERVED			GRAVITATIONAL WATER AT 20"									
Highly Permeable Material			N/O		NOT OBSERVED			SOIL RATING: SOMEWHAT LIMITED									
Bedrock			N/O		NOT OBSERVED												
Restrictive Layer			48		STRUCTURELESS												

Note : The evaluation should include a complete site plan or site drawing

Site and Soil Evaluation for Sewage Treatment and Dispersal

County:	LICKING	Land Use / Vegetation:	UNDEVELOPED	WOODS
Township / Sec.:	HOPEWELL	Landform:	UPLAND	
Property Address/Location:	0 FLINT RIDGE RD. NEWARK, OH 43055	Position on Landform:	HILLSLOPE	
		Percent Slope:	12%	
Applicant Name:	COUNTRYTyme-J. LONGHENRY	Shape of Slope:	CONVEX	
Address:	3451 CINCINNATI-ZANESVILLE RD. LANCASTER, OH 43130	Date:	February 3, 2025	AOP SOILS PROFESSIONAL ODH APPROVED SOIL EVALUATOR
Phone #:	(614) 989-9394	Evaluator:	KYLE BALDWIN, GEOLOGIST	
Lot #:	033-103422-00.010	Evaluator:	KYLE BALDWIN	
Test Hole #:	5	Signature:		
Latitude/Longitude:	39.9887, -82.24324	Phone#:	740-704-1879	
Method:	Pit Auger ☒ Probe			

Soil Profile		Estimating Soil Saturation				Estimating Soil Permeability							Loading Rates					
		Munsell Color (hue, value, chroma)																
		Depth (inches)	Matrix Color	Redoximorphic Features		Texture			Structure		Consistence							
Concentrations	Depletions			Class	Approx. % Clay	Approx. % Fragments	Grade	Size	Type (shape)									
Horizon																		
A	4	10YR 4/3				SIL	20	0	2	M	GR	FR	0.6	0.8	TBD			
Bt1	20	10YR 5/4				SIL	20	0	2	F	SBK	FR	0.6	0.8	TBD			
2Bt2	34	10YR 5/4	10YR 3/2	10YR 6/2		CL	30	10	2	M	SBK	FI	0.4	0.6	TBD			
2BC	48	10YR 5/4	10YR 3/2	10YR 6/1		CL	30	10	2	CO	SBK	FI	0.4	0.6	TBD			
2C	60	10YR 5/4	10YR 3/2	10YR 6/1		CNCL	30	20	0	0	0	FI	0.0	0.0	TBD			
Limiting Conditions		Depth to (in.)	Descriptive Notes				Remarks / Risk Factors/ Soil Rating:											
Perched Seasonal Water Table		20	REDOXIMORPHIC FEATURES PRESENT				GRAVITATIONAL WATER AT 20"											
Apparent Water Table		N/O	NOT OBSERVED				SOIL RATING: SOMEWHAT LIMITED											
Highly Permeable Material		N/O	NOT OBSERVED															
Bedrock		N/O	NOT OBSERVED															
Restrictive Layer		48	STRUCTURELESS															

Note : The evaluation should include a complete site plan or site drawing.